WORK PERMIT #					
ILR/Work Order # Dept. Account #89/9					
1. Work requester fills out this section					
Requester: J. Collins Date: 8-12-98 Dept/Div/Group: Phenix Other Contact person (if different from requester): Kery Jones Phone No. Start Date 8-19-98 Estimated End Date Description of Work / Problem: Poly JE RICH DETECTOR					
Building 832 Room Hick Bay Equipment					
2. Work requester, work provider, and ES&H (as necessary) jointly fill out this section or attach applicable					
hazard analysis					
Hazard Analysis					
RADIATION [] NONE [] Activation [] Airborne [] Contamination [] Radiation [] OTHER					
SAFETY [] NONE [] Corrosive / [] Flammable [Material Handling Rigging/Critical Lift CONCERNS [] Asbestos [] Cryogenic [] Fumes/Mist/Dust [] Noise [] Toxic [] Biohazard [] Electrical [] Heat/Cold Stress [] Non-ionizing Radiation [] Vacuum [] Chemicals [Elevated Work [] Hydraulic [] Oxygen Deficiency [] OTHER [] Confined Space [] Excavation [] Lasers [] Penetrating Fire Wall [] Adding / Removing Walls or Roofs [] Lead [] Pneumatic					
VIRONMENTAL CONCERNS I → NONE I → NON					
Waste Generated [4NONE [] Clean Waste [] Hazardous Waste [] Radioactive Waste [] Mixed Waste Waste [] Waste disposition by:					
Based on analysis above, the Review Team determines the job hazard category:					
JOB HAZARD CATEGORY: MODERATE HIGH					
Job Safety Analysis (JSA) Required? No Yes (Please attach)					
Work Controls WORK [INONE [] Containment [] IH Survey [] Scoffelding requires in continu					
PRACTICES [] NONE [] Containment [] IH Survey [] Scaffolding - requires inspection [] Exhaust Ventilation [] Barricades [] HP Coverage [] Posting/Warning Signs [] OTHER					
PROTECTIVE [] NONE [] Ear Plugs [] Gloves [] Lab Coat [] Safety Glasses EQUIPMENT [] Coveralls [] Ear Muffs [] Goggles [] Respirator [] Safety Harness [] Disposable Clothing [] Face Shield [] Hard Hat [] Rubbers [] Safety Shoes [] OTHER					
PERMITS Initial next to box to show who has responsibility to generate the permit [] Confined Space Entry (ES&H 2.2.4) [] Digging/Core Drilling(ES&H 1.18.0) [] Impair Fire Protection Sys. (ES&H 4.2.0) [] Cutting/Welding (ES&H 4.3.0) [] Electrical Working Hot (ES&H 1.5.0) [] Rad Work Permit (BNL RadCon Manual) [] Dept/Div Specific Permit [] Dept/Div Specific Permit [
DOSIMETRY/ [INONE					
raining Requirements (List below any location specific training requirements)					

Work Plan (procedures, timing, person	ovider coordinate	on work pla	n (use attachments for	detailed plans)	
(procedures, mining, person	mei, etc.).				
SEE ATTAC	hed.				
Special Working Conditions Required:				85	
special Working Conditions Requires.		***************************************			
Operational Limits Imposed:					
Dood Want Tasting Day 1					
Deviewed Dev \$37.4. D. C. di	.77 7.				
Reviewed By: *Note: Primary facility rather Title Name (pr		1000 <u>-</u>	A CAMPAGNA AND AND AND AND AND AND AND AND AND A	710 11 7	
Primary Reviewer — T. Collis	inty	Muh	gnature	Life # Date	
ES&H Services 5. KAN &	75	10/2	3 min	14795 8-12-98	
Other * — T. OMALL	EY Con	not The		19894 <u>8/27/98</u> 21336 8.14.98	
		No No Come	Tely .	01710	
4. Job site personnel fills out this see	ction				
Note: Signature indicates personnel perform		and understand	the hazards and narmit w	oguinam outa	
Job Site Supervisor	ing work have rous.	Contracto	r Supervisor	80. T . 1900 (1. 180 1884) (1. 4848)	
				LIIC #	
		- ,			
				<u> </u>	
5. Work Requester or designee fills of	out this section				
	AND REAL PROPERTY AND REAL PRO	is to a boom marie			
Conditions are Appropriate to Star Name	gnature (work per	mit has been revie	ewed, work controls are in place, Life #	and site is ready for job.) Date	
6. Work Requester determines if Pos		eauired		Date	
YES NO		7			
Post Job Review by ES&H Coordinator:	•	200 <u>200 200</u>	Life #:	Date:	
	Name		Initial		
Other Closeout Signatures (as necessary			Life #:		
Other Closeout Signatures (as necessary	'):		Life #:	Date:	
7. Worker provides feedback					
Worker Feedback:					
Supervisor: Is worker feedback required	d on this iob?	NO	YES (attach feed)	hack form)	
Worker: Any feedback on safety concer					
on ways to improve the job?		NO	YES (ask for form if not attached)		

FLORIDA STATE UNIVERSITY NUCLEAR PHYSICS DEPARTMENT

RICH PROJECT

GAS VESSEL HANDLING: Equipment & Pivot Procedures FSU-RP-P05

> Florida State University Tallahassee, FL 32306 (850) 644-4100

GAS VESSEL HANDLING: Equipment & Pivot Procedures

CONTENTS

- I. INTRODUCTION
- II. SCOPE
- III. RESPONSIBILITIES
- IV. PRE-PIVOT PROCEDURE
- V. PIVOT PROCEDURE
- VI. REMOVAL OF LIFTING FRAME

Reference documents.

Ref drawings 0020207019. Lifting Fixture Load test data.

I. INTRODUCTION

This procedure is for the safe handling of the <u>Rich Gas Vessel</u> while pivoting into the mirror alignment position, using the <u>Rich Gas Vessel Lifting Fixture</u>. It will eliminate danger to workers at Brookhaven National Laboratory (BNL). This procedure will provide detailed instructions for pivoting and securing vessel in the alignment position.

II. SCOPE

This procedure gives the minimum requirements for pivoting the gas vessel into its alignment position. It applies to BNL personnel, outside contractors, contract labor and to personnel designated to operate equipment covered by this procedure. Safety standards provided by BNL for Material Handling.

III. RESPONSIBILITY

- Florida State University (FSU): A qualified representative of FSU will be on site as a consultant during the following operations
- BNL: BNL will provide appropriate personnel for hoisting, rigging, crane operation, line supervision, and the appropriate equipment with verifications for the following operation:

Equipment BNL should provide:
Crane hook in building 832, rated for 25,000 lb. min
Four12' long slings, rated for 25.000 lb. min (to lift gas vessel).
Two 10,000 lb. chain falls.
Hardware to connect slings to crane hook.
Shackles rated 20,000 min
Spreader bar rated for 15 tons
Rich lifting fixture
Load cell

IV. PRE-LIFTING PROCEDURE


- Check toque values on 1"8 bolts attaching transition plates to vessel (160 ft LB). Check toque values on 1"-8 bolts Rich lifting fixture to transition plates (220 ft lb.) (Fig 1).
- 2. Check bolts in floor stands are tightening to correct values.
- 3. Remove roof section of tent above Rich gas vessel.
- Make sure area around the rich is clear
- Check for tools and any loose parts in the PMT arrays and vessel in general.

V. PIVOTING PROCEDURE

- Move crane into position to pick up15 ton spreader bar, hook load cell between hook and spreader bar.
- 2. Move spreader bar through roof opening in tent to a position to Attach12' slings and shackles to ends of spreader bar (See Fig 2).
- 3. Attach 12' slings to top end of lifting frame
- 4. Attach chainfalls and slings to top end of lifting frame
- 5. Leave chainfalls and chain fall slings loose (See Fig 2).
- 6. Start lift as vessel razes Move Bridge to the east (See Fig 3).
- 7. Move concrete blocks into position and attach chainfalls and slings. (See Fig 4).
- 8. Continue to raze vessel with crane, moving bridge to the east and keeping chain falls loose.
- 9. Take up on chain fall as vessel approaches pivot pinot (See Fig 4).
- 10. Check load cell as vessel weight goes over pivot point
- 11. The crane must not exceed this point (See Fig 5).
- 12. Eases down on chainfall keeping crane hook taught till vessel rests on back mounts.

VI. REMOVAL OF LIFTING FIXTURE

- 1 Attach chainfalls on lower host rings with crane in same position (See Fig 6)
- 2 Attach slings and chainfalls to crane hook.
- 3. Take up on chainfalls till tight, this is to keep the frame from swinging out from the gas vessel in an uncontrolled manner.
- 4. Attach guidelines to lifting frame.
- 5. Remove 1" 8 bolts from top transition plates (See Fig 6).
- 6. Remove 1*-8 bolts from bottom lifting frame at the transition plate connection leaving transition plate attach to vessel. (See Fig 6).
- 7. At this time lifting fame will be free of gas vessel.
- Raze crane hook and move to the west moving frame away from the gas vessel, lower frame to the ground and remove from area (See Fig 6).
- 9. Vessel is now ready for mirror alignment.

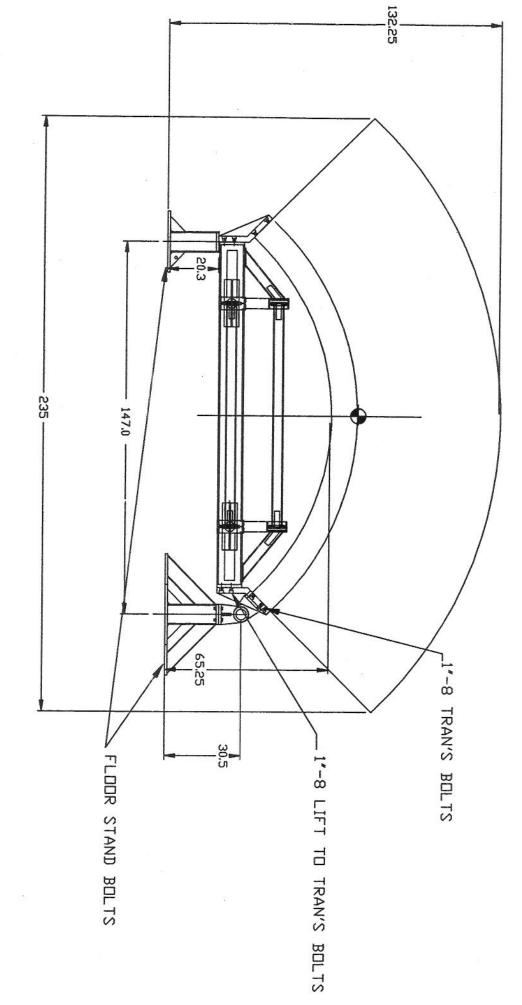

WITH LIFTING FRAME AND TRANSITION PLATES INSTALED

